

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-066	Smoke	9/8/2008	ADS/TM	S13II1021MH	Dry	Yes	2,157.37



Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-066	Smoke	9/8/2008	ADS/TM	S13II1021MH	Dry	Yes	2,157.37

Isolated Pipes

Pipe ID	Upstream MH	Downstream MH	Length (ft)	Diameter (In)
S13II1014G1	S13II1014MH	S13II1021MH	236.7169	8
S13II1050G1	S13II1050DE	S13II1007MH	224.2629	8
S13II1023G1	S13II1023MH	S13II1014MH	403.9228	8
S13II1040G1	S13II1040MH	S13II1016MH	241.9571	8
S13II1021G1	S13II1021MH	S13GG1026MH	309.9630	8
S13II1007G1	S13II1007MH	S13II1023MH	238.1486	8
S13II1016G1	S13II1016MH	S13II1007MH	30.14682	8
S13II1054G1	S13II1054DE	S13II1016MH	222.6310	8
S13II1048G1	S13II1048MH	S13II1021MH	249.6201	8

Observations & Photos

Obs_ID S1028-066-OB01

Address 4313 Park Heights Ave


Status Private

Source Cleanout

Location Yard - front

Nearest MH S13GG1026MH

Comments Smoke from cleanout in front yard. 4313 Park Heights Ave

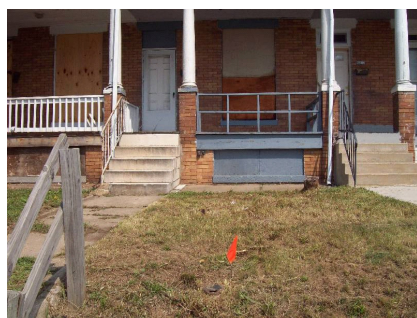

Picture \S1028-066-OB01-P01.jpg

Comments Front of house, 4313 Park Heights Ave

Obs_ID S1028-066-OB02

Address 4307 Park Heights Ave


Status Private

Source Cleanout

Location Yard - front

Nearest MH S13GG1026MH

Comments Smoke from cleanout in front yard. 4307 Park Heights Ave

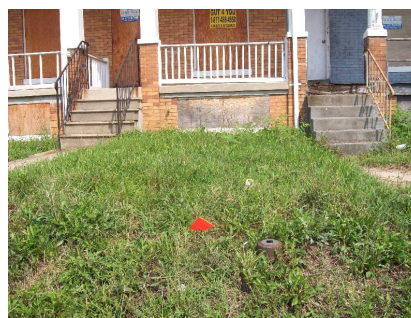

Picture \S1028-066-OB02-P01.jpg

Comments Front of house, 4307 Park Heights Ave